

Knowledge Base Article

Product Group: Alignment

Product: TKSA 60, TKSA 80 Shaft Alignment Systems

Version: 1.4 and prior

Abstract

If any TKSA report which has targets set is generated, then the report will be generated correctly. However, any report which is generated after this which **does not** have any targets set will incorrectly adjust the alarm icons based on the old target values.

Overview

The defect described above will be fixed in firmware version 1.6. The following can be used as a workaround to the issue:

1. Generate all reports from the unit. Then, on the PC, save all reports which use targets (this will be displayed in the report).
2. Now, delete any jobs which use targets from the Display Unit.
3. Re-boot the Display Unit (2,7,8,9 keys).
4. Re-generate the remaining reports.

For further assistance, please contact the Technical Support Group by phone at 1-800-523-7514 option 8, or by e-mail at TSG-CMC@skf.com.